

Test Report

Number: GZHH0031423503

Applicant: BAREBONES SYSTEMS,LLC.
1215 EAST WILMINGTON AVENUE -STE.
140 SALT LAKE CITY, UT 84106

Date: Mar 21, 2019

Sample Description:

Five (5) pieces of submitted sample said to be :

Item Name : **Cutting Board**
Material Name : Maple/ Stainless steel
Country of Origin : China



Tests conducted:

As requested by the applicant, refer to attached page(s) for details.

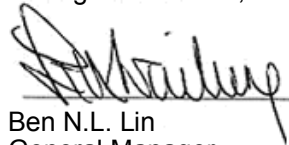
Conclusion:

Tested Samples
Tested components of
submitted samples

Standard
EU Technical Guide Council of Europe
Resolution CM/Res(2013)9 on metals and alloys
Used in Food Contact Materials and Articles on
specific migration of heavy metal

Result
Pass

Authorized by:
For Intertek Testing Services Shenzhen Ltd.
Guangzhou Branch, Hardlines


Ben N.L. Lin
General Manager



Page 1 of 3



Test Report

Number: GZHH0031423503

Tests Conducted

1 Release Testing on Metals and Alloys Used in Food Contact Materials and Articles

With reference to EU Technical Guide "Council of Europe Resolution CM/Res(2013)9 on metals and alloys Used in Food Contact Materials and Articles". Migration test was carried out and heavy metal content was determined by Inductively Coupled Plasma Optical Emission Spectrometer (ICP-OES) and Inductively Coupled Plasma Mass Spectrometer (ICP-MS) with reference to ISO 11885:2007 and ISO 17294-2:2003 respectively.

I. Test Condition:

Temperature: 40°C

Time: 0.5hours

II. Test Result:

Food simulant: Citric acid (5 g/L)

Tested component (1) :							
Elements	Result 1 st test (mg/kg)	Result 2 nd test (mg/kg)	Result 1 st test+Result 2 nd test (mg/kg)	Result 3 rd test (mg/kg)	Reporting Limit (mg/kg)	7*Limit (mg/kg)	Limit (mg/kg)
Silver (Ag)	ND	ND	ND	ND	0.05	0.56	0.08
Aluminium (Al)	ND	ND	ND	ND	1	35	5
Chromium (Cr)	ND	ND	ND	ND	0.02	1.75	0.250
Cobalt (Co)	ND	ND	ND	ND	0.01	0.14	0.02
Copper (Cu)	ND	ND	ND	ND	0.5	28	4
Iron (Fe)	ND	ND	ND	ND	1	280	40
Manganese (Mn)	ND	ND	ND	ND	0.1	12.6	1.8
Molybdenum(Mo)	ND	ND	ND	ND	0.02	0.84	0.12
Nickel (Ni)	ND	ND	ND	ND	0.1	0.98	0.14
Tin (Sn)	ND	ND	ND	ND	10	700	100
Vanadium (V)	ND	ND	ND	ND	0.005	0.07	0.01
Zinc (Zn)	ND	ND	ND	ND	1	35	5
Antimony (Sb)	ND	ND	ND	ND	0.01	0.28	0.04
Arsenic (As)	ND	ND	ND	ND	0.001	0.014	0.002
Barium (Ba)	ND	ND	ND	ND	0.1	8.4	1.2
Beryllium (Be)	ND	ND	ND	ND	0.01	0.07	0.01
Cadmium (Cd)	ND	ND	ND	ND	0.001	0.035	0.005
Lead (Pb)	ND	ND	ND	ND	0.005	0.070	0.010
Lithium (Li)	ND	ND	ND	ND	0.010	0.336	0.048
Mercury (Hg)	ND	ND	ND	ND	0.003	0.021	0.003
Thallium (Tl)	ND	ND	ND	ND	0.0001	0.0007	0.0001
Magnesium(Mg)	ND	ND	ND	ND	1	-	-
Titanium(Ti)	ND	ND	ND	ND	1	-	-



Page 2 of 3



Test Report

Number: GZHH0031423503

Tests Conducted

ND = Not detected(less than reporting limit)

Remark : The submitted sample is a repeated use article. The migration test was carried out three times on the same article. The sum of the results of the first and second tests should not exceed seven times the limit (Result 1st test + Result 2nd test < 7 * limit) and the Result 3rd test shouldn't exceed the limit.

Tested component(s) : (1) Black treated metal (handle).

Date sample received: Mar 01, 2019

Testing period: Mar 01, 2019 to Mar 11, 2019

End of report

This report is made solely on the basis of your instructions and/or information and materials supplied by you. It is not intended to be a recommendation for any particular course of action. Intertek does not accept a duty of care or any other responsibility to any person other than the Client in respect of this report and only accepts liability to the Client insofar as is expressly contained in the terms and conditions governing Intertek's provision of services to you. Intertek makes no warranties or representations either express or implied with respect to this report save as provided for in those terms and conditions. We have aimed to conduct the Review on a diligent and careful basis and we do not accept any liability to you for any loss arising out of or in connection with this report, in contract, tort, by statute or otherwise, except in the event of our gross negligence or wilful misconduct. This report shall not be reproduced unless with prior written approval from Intertek Testing Services Shenzhen Limited, Guangzhou Branch.



Page 3 of 3

